

STERLITECH

C o r p o r a t i o n

Sepa FO Cell - 316SS

Assembly & Operation Manual



Table of Contents

Introduction 3

316SS Sepa FO Cell Components 4

316SS Sepa FO Cell Assembly 5

316SS Sepa FO Cell System Assembly 6

Operation of the 316SS Sepa FO Cell 7

Supplementary Operating Information 8

Accessory and Spare Part Ordering Information 9

Return Material Authorization 9

Warranty 9

Technical Assistance 9

Introduction

The Sepa FO Cell is a laboratory-scale filtration unit that is designed to evaluate a variety of Osmotically Driven Membrane Processes (ODMP), including Forward Osmosis (FO) and Pressure Retarded Osmosis (PRO). It simulates the flow dynamics of larger, commercially available membrane elements such as industrial spiral wound membrane elements. By using a combination of shims, feed spacers, and membranes, users can vary the operating conditions and fluid dynamics over broad ranges.

Table 1 outlines the operational parameters and technical specifications of the 316SS Sepa FO Cell.

Prior to operating or servicing this device, this manual must be read and understood.

Table 1: 316SS Sepa FO Cell Features and Technical Specifications

PARAMETER	DESCRIPTION
Membrane Operation	Forward Osmosis
Cell Material	316 Stainless Steel
Membrane Active Area	140 cm² (22 in²)
Maximum Pressure	69 bar (1000 PSI)
Maximum Temperature*	150°C (302°F)
Recommended Feed Rate	0.5-6 LPM (0.13-1.6 GPM)
Channel Dimensions	
Channel Depth	1.9 mm (0.075 in)
Channel Width	95.3 mm (3.75 in)
Fittings	
Feed Inlet/Outlet Size (Tube OD)	3/8" Compression
Draw Inlet/Outlet Size (Tube OD)	3/8" Compression
Securing Method	Hydraulic Cell Holder & Hand Pump**


* Maximum Pressure and Temperature ratings are dependent on a variety of factors. Listed values are guidelines based upon material properties and cannot be guaranteed in every application.

** The hydraulic hand pump is sold separately and required for operation of the Sepa Cell.

316SS Sepa FO Cell Components

Figure 1 illustrates a typical assembly of the Sepa FO Cell. The cell is also packaged with a membrane cutting template.

Figure 1: 316SS Sepa FO Cell Assembly

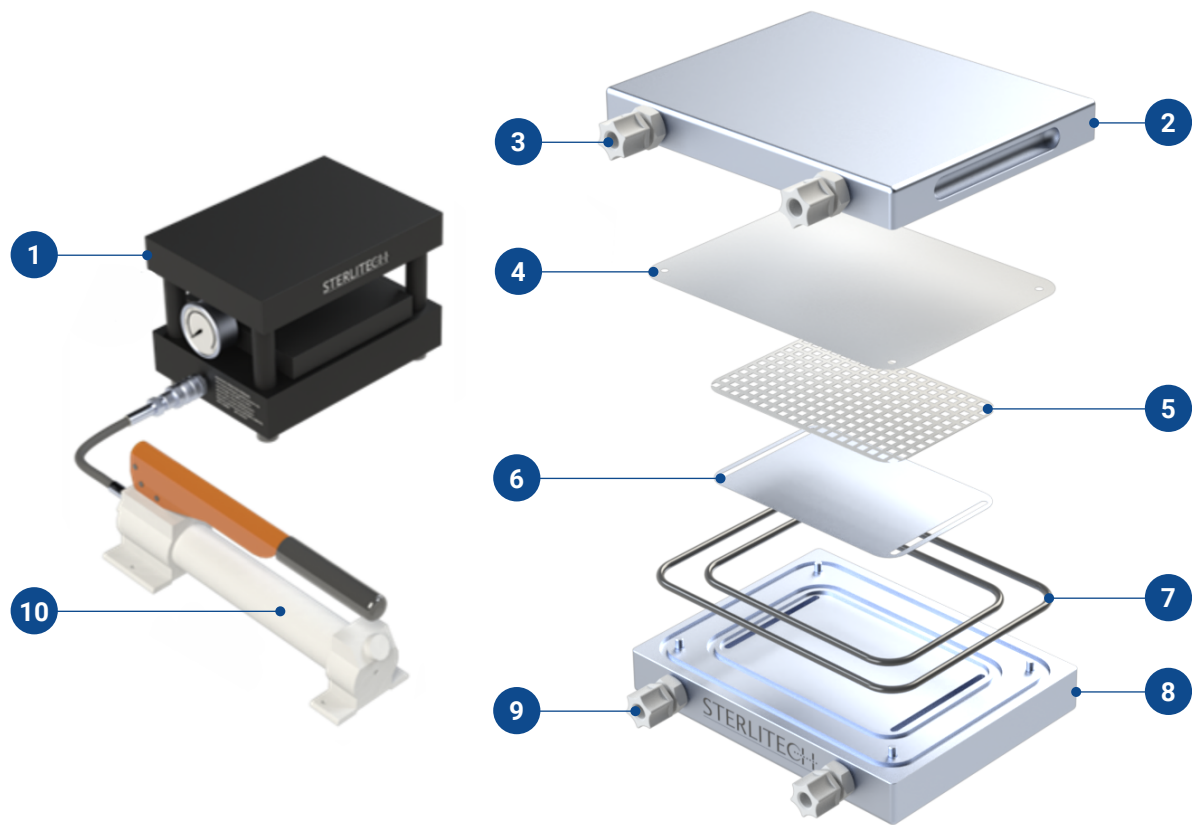

NUMBER	DESCRIPTION	MATERIAL	WETTED?
1	Hydraulic Cell Holder	Coated Aluminum	No
2	Cell Top	316 Stainless Steel	Yes
3	Draw Inlet/Outlet Fittings	Polypropylene	Yes
4	Membrane	Various	Yes
5	Feed Spacer	Polypropylene	Yes
6	Shim **	316 Stainless Steel	Yes
7	O-Rings	Viton*	Yes
8	Cell Bottom	316 Stainless Steel	Yes
9	Feed Inlet/Outlet Fittings	Polypropylene	Yes
10	Hydraulic Hand Pump	Aluminum	No

* Standard, Other Materials Available

** Not Included, Available for purchase

316SS Sepa FO Cell Assembly

To assemble the Sepa Cell: [\(Video\)](#)

1. Wet the O-rings with a small amount of water or the fluid to be processed and install them into the grooves on the cell bottom. [\(Video\)](#)

Caution: Make sure that the O-rings lie flat in the grooves of the cell bottom. Leaking may occur if the O-rings do not lie flat in the grooves. The O-rings will be cut or crushed when the system is operating if the O-rings are not installed correctly.

2. Optional: Install shim(s) into the channel of the cell bottom followed by the selected spacer. Spacers should be selected first, based on the desired thickness; shims should then be selected to fill the remaining channel depth. The overall channel depth is 0.075".
3. Place a piece of pre-cut membrane onto the cell bottom using the two alignment pins to hold the membrane in position. The membrane should be installed with the shiny side (active side) down, toward the cavity in the cell bottom.

Note: If you are cutting your own membranes, the membrane's outer edge should fit between the inner and outer O-rings in the cell body to prevent leakage.


4. Wet the permeate carrier with water or the fluid to be processed and place it into the cavity in the cell top. The surface tension caused by wetting the carrier will keep it in place.
5. Place the cell top onto the cell bottom. The alignment holes in the top should fit over the alignment pins in the cell bottom.
6. Insert the cell body into the cell holder until it rests against the two stops in the back of the cell holder. Attach the hydraulic hand pump (not included) to the quick disconnect fitting on the side of the cell holder.

Note: The cell holder is filled with Mobil DTE 20 Series hydraulic oil. It is recommended to use Sterlitech's hand pump to match the oil type and ensure compatibility.

316SS Sepa FO Cell System Assembly

The 316SS Sepa FO Cell requires a forward osmosis system to operate, such as a [Benchtop System](#) or [Skid System](#). Alternatively, **Figure 2** lists the key components required to operate a Sepa cell. These components are sold separately and can be found [here](#).

Figure 2: Forward Osmosis System Diagram for 316SS Sepa FO Cell

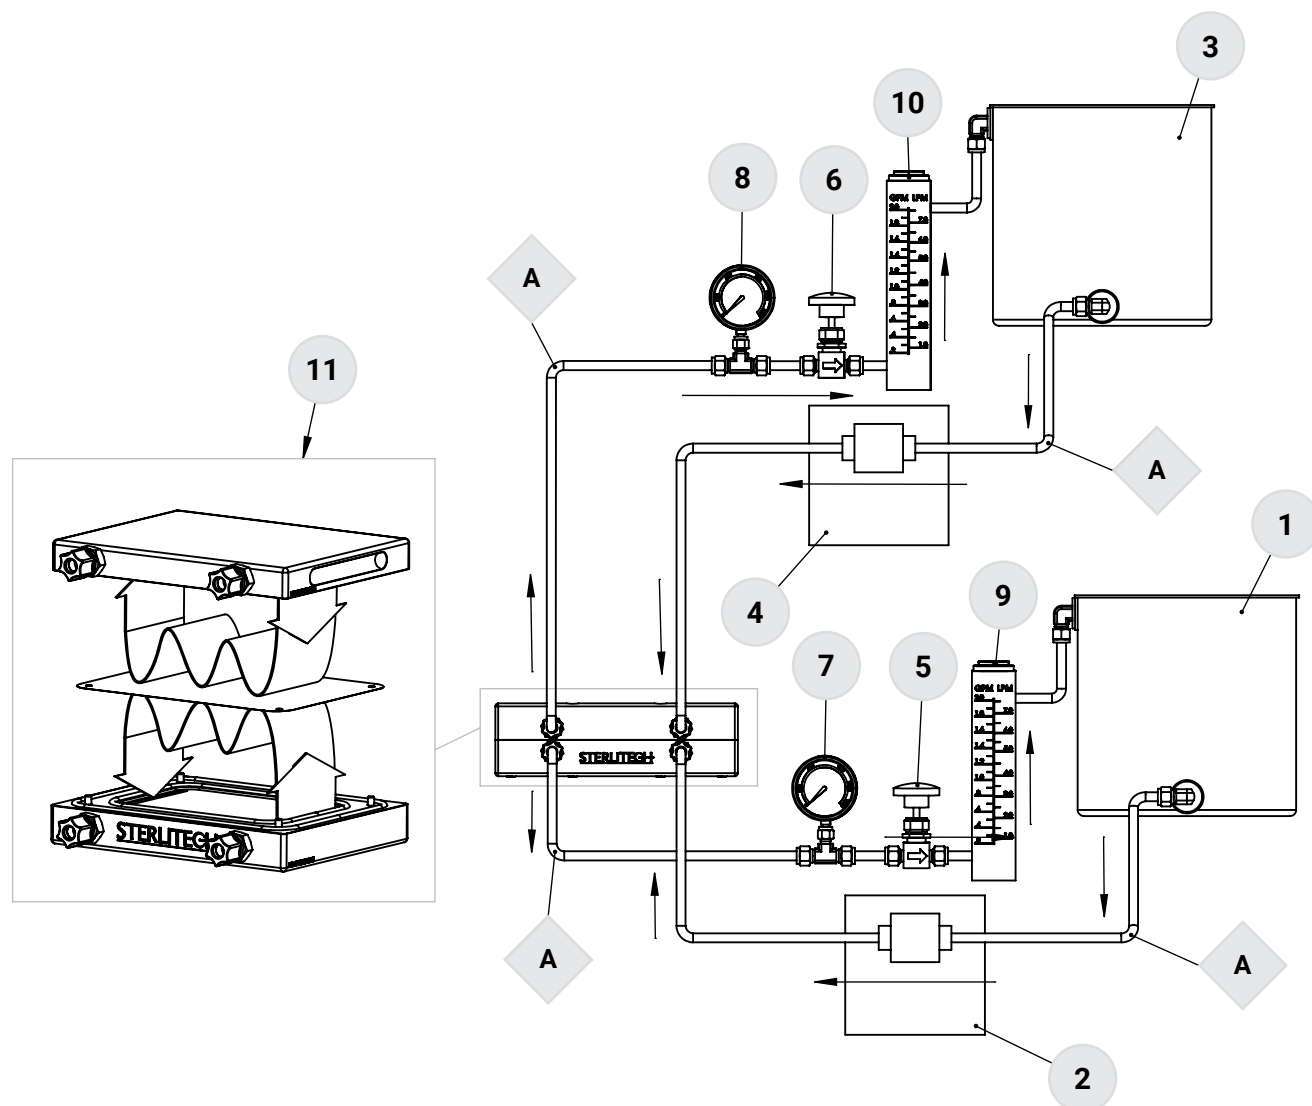

Legend

1	Feed Tank
2	Feed Pump
3	Draw Solution Tank
4	Draw Solution Pump
5	Concentrate Control Valve
6	Draw Solution Pressure Control Valve

7	Concentrate Pressure Gauge
8	Draw Solution Pressure Gauge
9	Concentrate Flow Meter
10	Draw Solution Flow Meter
11	316SS Sepa FO Cell
A	Low Pressure Tubing

Operation of the 316SS Sepa FO Cell

After assembling the Sepa CF Cell into the cell holder and attaching the hand pump, the cell can now be operated with the system.

To operate the Sepa FO Cell:

1. Close the hand pump relief valve knob (turn clockwise) and operate the hand pump. Set the cell holder pressure at or above the intended system pressure (up to 1000PSI).
2. Open all the valves in the system to relieve any pressure build-up before turning on the feed pump.
3. Turn the system ON and set the feed pump to desired flow rate.

Note: *If a bypass line is present, slowly close the bypass control valve; this valve is required only at low pressures and flows. Leaving the bypass line slightly open can also help to stabilize the system.*

4. Set the feed pressure by gradually closing the concentrate control valve assembly. Do not exceed the maximum pressure rating of the cell, holder, membrane or system.

Note: *A good starting point may be to set the system at 1.7 bar (25 PSI) pressure for ultrafiltration or 17.2 bar (250 PSI) for reverse osmosis.*

5. Verify the feed pressure reading on the concentrate pressure gauge.
 6. Adjust the concentrate flow control valve to obtain the desired pressure and flow.
- Note:** *Experimentation is required to determine the optimum settings of pressure, flow rate, and shim/spacer combination to use on the chosen membrane and the fluid being processed.*
7. Once the experiment is complete, shut down the system by turning the feed pump OFF and opening all the valves to relieve any pressure build up. Relieve the cell holder pressure by turning the relief valve knob counterclockwise.

To replace a membrane filter:

1. Turn the feed pump OFF.
2. Open all the valves in the system to relieve any pressure build up.
3. Turn the pressure relief valve knob on the hydraulic hand pump counterclockwise to release the pressure in the cell holder.
4. Slide the cell out of the cell holder.
5. Lift off the cell top from the cell bottom.
6. Remove the membrane.
7. Install the new membrane.
8. Place the cell top back onto the cell bottom.
9. Insert the cell into the cell holder.
10. Repressurize the cell holder using the hand pump.

Supplementary Operating Information

Additional Resources

- [MPD Cell Quick Reference Guide](#)
- [MPD Video Channel](#)
 - Cell Assembly
 - Shim and Spacer Installation
 - System Operation
- [FO Filtration Handbook](#)
 - Basics of Cross Flow Filtration
 - FAQs
 - Example Studies
 - Preconditioning Membranes
 - Temperature Effect on Membranes
- [How to Swage a Compression Fitting](#)
- [How to Cut Custom Membrane Filters](#)



Recommended Blog Articles

- [How to Calculate Cross Flow Velocity](#)
- [How to Select a Spacer](#)
- [How to Clean Membranes](#)

Analyzing Membrane Performance Results

Spiral wound membranes containing mesh spacers are usually operated with a fluid velocity across the membrane surface of 0.1-0.5 m/sec (0.3-1.6 ft/sec). Higher velocities in membranes may lead to excessive pressure differential across the membrane and possible damage. Hollow fiber membranes, tubular membranes, and membranes with tubular spacers may be operated at higher velocities, but this may not contribute to a more effective operation.

Other parameters such as viscosity, pressure, and suspended solids may also affect performance/operation. Experimentation with the Sepa Cell can help predict the best operating parameters.

Cell and Membrane Cleaning

The Sepa Cell can be cleaned with or without the membrane installed. Leave the membrane installed to simulate the cleaning conditions of Clean-In-Place (CIP), a common practice in larger systems with spiral-wound or tubular membranes.

During CIP, cleaning solutions are re-circulated and, in some cases, allowed to sit for a period of time within the cell body. In some cases, the feed pump can be used to re-circulate the cleaning solutions.

Refer to the Membrane Cleaning Blog linked above for recommended cleaning instructions.

Accessory & Spare Part Ordering Information

PRODUCT	LINK
System Components (Pump, Flow Meters, Pressure Gauges, etc.)	System Components
Sepa Shim Assortment Pack	1231104
Sepa Feed Spacer Assortment Pack	1232558
Sepa Steel Rule Die	Sepa Die
Membrane Packs	Flat Sheet Membranes
Spare Parts (Alternative O-Rings, Sintered Support Plate, Knobs)	Spare Parts

Product Support

Return Material Authorization

If materials are to be returned to Sterlitech for repair, evaluation, or warranty consideration, a Return Material Authorization (RMA) number and form must be obtained from Sterlitech prior to the return. Contact Sterlitech's Customer Service Department for these forms.

Be sure to include a complete, detailed written reason for the return. Also, include serial numbers, installation and removal dates, and any other information that is available. The crossflow cells have a serial number imprinted on them.

Indicate the proposed disposition of the material, and reference the RMA number on all packages or cartons. All material must be shipped to Sterlitech with freight prepared by the customer.

Warranty

The following is made in lieu of all other warranties expressed or implied. Sterlitech Corporation guarantees equipment to be free from defects in material and workmanship when operated in accordance with written instructions for a period of one year from receipt. Parts not manufactured by Sterlitech are covered by their manufacturer's warranties, which are normally for one year.

Manufacturers and Seller's only obligation shall be to issue credit against the purchase or replacement of equipment proved to be defective in material or workmanship. Neither manufacturer nor seller shall be liable for any injury, loss or damage, direct or indirect, special or consequential, arising out of the use of, misuse, or the inability to use such product.

The information contained herein is based on technical data and tests, which we believe to be reliable, and is intended for use by persons having technical skill at their discretion and risk. Since conditions of use are outside Sterlitech's control, we can assume no liability whatsoever for results obtained or damages incurred through the application of the data presented.

This information is not intended as a license to operate under, or a recommendation to infringe upon, any patent of Sterlitech or others covering any material or use. The foregoing may not be altered except by a written agreement signed by officers of the manufacturer.

Technical Assistance

Please contact us if you have any questions or technical inquiries about our products by calling Sterlitech Corporation at **1-877-544-4420** or by visiting www.sterlitech.com.

Company Background

Founded in 2001 in Kent, WA, Sterlitech Corporation manufactures and markets filtration-focused laboratory products to a broad spectrum of scientific and industrial sectors. Its line of flat sheet membranes and tangential flow cells deliver industry-leading performance reliable results. Configured for reverse osmosis, nanofiltration, ultrafiltration, and microfiltration applications, Sterlitech's benchtop cross flow membrane test system provides the versatility required to innovate.

Sterlitech's comprehensive line of products is supported by the expertise of its technical specialists who can assist with application-specific product selection, and provide customized solutions where necessary. Unique problem-solving approaches, flexibility, and consistent quality have made Sterlitech Corporation a renowned global provider of filtration products and equipment.

Sales Inquiries

sales@sterlitech.com

Accounts Payable

AP@sterlitech.com

Accounts Receivable

AR@sterlitech.com

Press Inquiries

PR@sterlitech.com



STERLITECH

4620 B Street NW, Suite 101
Auburn, WA 98001 USA
Tel: 877-544-4420 or 1-253-437-0844
Fax: 1-253-437-0845
Email: info@sterlitech.com

© 2024 Sterlitech Corporation